The Dalles Dam Fishway Status Report

5/30/2021

Inspection Period: 5/26-5/29

THE DALLES DAM



The Dalles Project-Fisheries P.O. Box 564 The Dalles, OR 97058-9998 Phone: 541-506-3800

The Dalles Dam	Inspections	Criteria	Total Number of Ins		15	Temperature: 57.7 °F	
THE Dance Dan	OOC	Limit	Comments:	AWS OFF		Weekly Ave. Secchi: 4.	.7
			NORTH F	ISHWAY			
Exit differential	0	≤ 0.5'					
Count station differential	0	≤ 0.3'					
Weir crest depth	0	1.0' ± 0.1'					
Entrance weir N1	0	1.0' - 2.0'	Weekly average	10.1			
Entrance Differential	0		Weekly average	1.3			
Entrance weir N2	0	Closed					
PUD Intake differential	0	≤ 0.5'					
			EAST FIS	SHWAY			
Exit differential	0	≤ 0.5'					
Removable weirs 154-157	0	Per forebay					
Weir 158-159 differential	0	1.1' ± 0.1'					
Count station differential	0	≤ 0.3'					
153 Weir crest depth	0	1.0' ± 0.1'					
Junction pool weir JP6	0	> 7.0'					
East entrance differential	0	1.0' - 2.0'		Week ave. 1.5			
Entrance weir E1	0	No criteria					
Entrance weir E2	0	depth (≥ 8')		Week ave. 11.6			
Entrance weir E3	0	depth (≥ 8')		Week ave. 12.2			
Collection channel velocity	0	1.5 - 4 fps	2.82 fps 5/26/21	Range MU1 2.82- MU2	21 3.58 fps	;	
Transportation channel velocity	0	1.5 - 4 fps	2.31 fps 5/26/2021				
North channel velocity	0	1.5 - 4 fps	2.44 fps, 5/21/2021				
South channel velocity	0	1.5 - 4 fps	3.13 fps 5/26/21				
West entrance differential	0	1.0' - 2.0'	Old SCADA	Week ave. 1.5			
Entrance weir W1	0	depth (≥ 8')		Week ave. 1.5			
Entrance weir W2	0	depth (≥ 8')		Week ave. 11.8			
Entrance weir W3	0	No criteria	Closed				
South entrance differential	0	1.0' - 2.0'		Week ave. 1.5			
Entrance weir S1	0	depth (≥ 8')		Week ave. 10.0			
Entrance weir S2	0	depth (≥ 8')		Week ave. 9.4			
			JUVENILE F	PASSAGE			
Sluicegate operation	0	Units 1, 18	Gates over MU1/1-2	-3,MU8/1-3,MU18-2 ope	n		
Turbine trashrack drawdown	0			within drawdown criteria.			
Spill volume/pattern	0	1 to 8	Spilling 8 gates.				
Turbine Unit Priority	0	per FPP					
Gatewells	0		No mortality. Decrea	asing #s of salmon fry a	nd smolts	in gatewells, 5/12/2021	

OTHER ISSUES:

Current Unit Outages

MU12 OOS 0001 4/12/2021 - 1700 10/27/2022 for Annual & Cooler Upgrades

T10 (MU19 and 20) OOS 10/27/22 acetylene levels

Maintenance

PUD intake rake returned to service with temporary power. Exploring permanent options.

Five of 6 east fishway collection channel dewatering pumps removed for repair/rehab. Work to resume in July.

Fishway automation replacement on hold from lack of staff. East exit, east and south entrances complete. West and north operating with old system.

Calibrations for east entrance weir E3 lower than actual opening. All in criteria >8'. Maintenance notified.

AWS backup system closed just prior to return to fish unit 1. Intake differential increased requiring a second closure cycle to clear. Visible milfoil floated off.

Spillway assessment (MRER); Spillgates 1- 9 rehab date estimate 2034. Includes replacement of spillbay 9 trunnion pin repair

Predators

Heron numbers increasing (up to 8) inside east fishladder Finding Shad morts atop weirs. Doing frequent ladder walks and USDA hazing when they can. Cormorants feeding at east fishway exit. Hazing when we can.

High gull numbers with aggressive foraging below spillway in SW3 and 4. High cormorant nest numbers (50-60) on BPA towers.

No opportunity for Green laser use for piscivorous bird hazing testing.

Pikeminnow dam angling ongoing. Removing native pikeminnow, yet All invasive bass/walleye by-catch continue to be RELEASED per state requirement.

Processing PIT tag data recovered. Camera monitoring within fishway for possible avian predators.

Research/Construction/Contractors

Fish counters started Apr1. No issues.

AWS intake trashrack - EDR funded for FY21 to investigate solution for debris plugging issue. PDT meetings in progress.

PITAGS north and east fishladder data collection at count stations continues.

Fish unit rehab - Phase 1A on hold. Planning operation with AWS backup water supply during construction.

Fishway Operations

Ice Trash sluiceway opened 24/7. MU1/1-2-3, MU 8/1-3, MU18/2


East and north fishladders in full operation per Fish Passage Plan.

New automation installed at east exit, east entrance and south entrane working well with minor adjustments.


Spillway open at 40% river flow


Approved by: Ron Twiner, Operation Project Manager, The Dalles Dam

New Avian Lines and laser deterrent zones

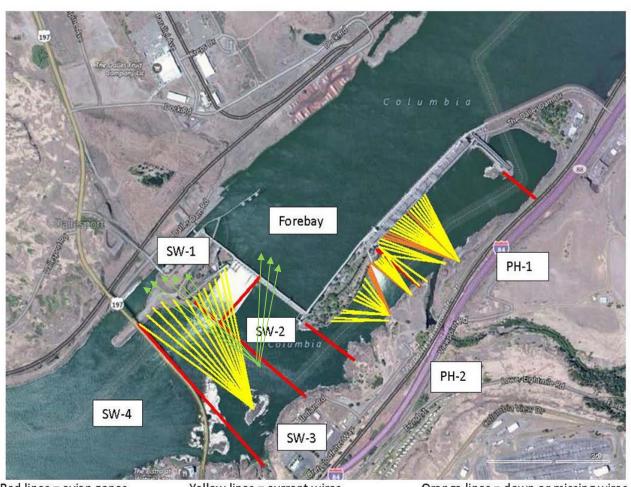



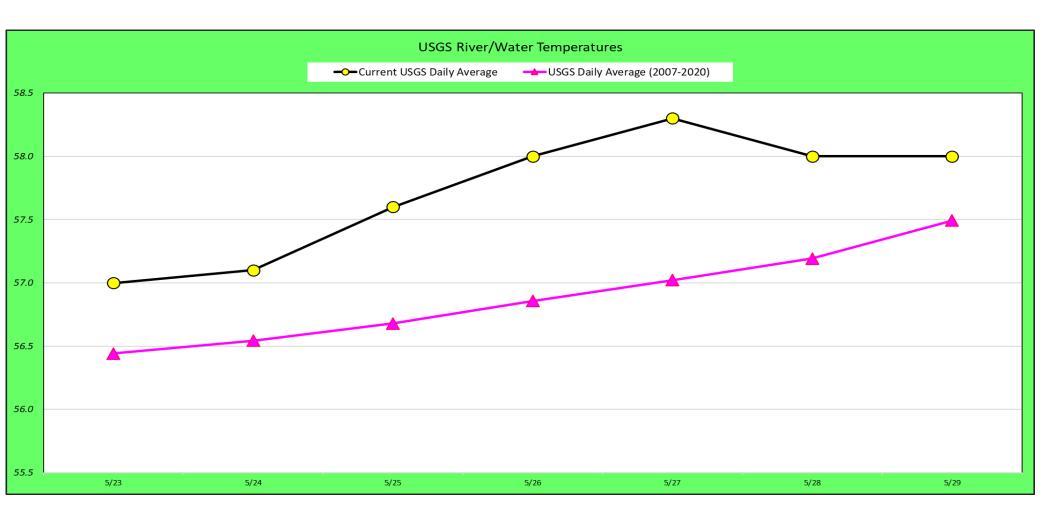

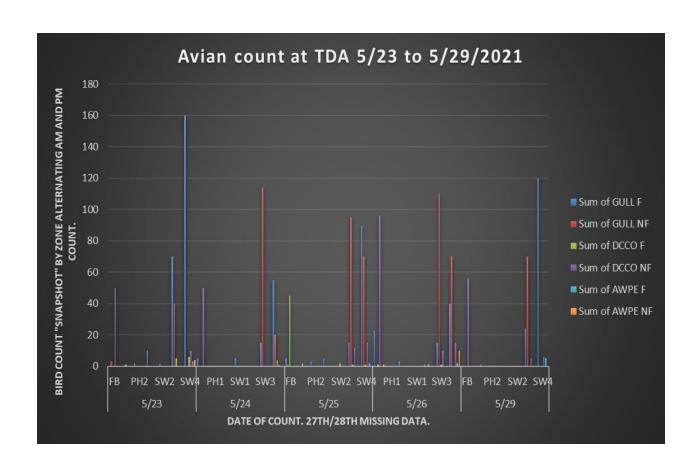

_				_
	Secchi:		°F	USGS May
5/16	5.0	Sun	57.0	
5/17	5.0	Mon	57.1	
5/18	5.0	Tue	57.6	
5/19	5.0	Wed	58.0	
5/20	4.0	Thurs	58.3	
5/21	4.0	Fri	58.0	
5/22	5.0	Sat	58.0	
	4.7	AVG	57.7	

The Dalles Dam Daily Readings and Averages for

Temperatures, Secchi, Entrances, and Spill


E1 and W3 do not have criteria opening.
E3 value 1' '~ more than actual.
out of criteria

	North Ladder		East Ladder											
Date:			East Entrance				West Entrance			South Entrance				
	Differential	N1 Depth	Differential	E1 Depth	E2 Depth	E3 Depth	JP 6	Differential	W1	W2	W3	Differential	S1	S2
5/23	1.3	10.1	1.5	9.0	11.1	11.1	13.1	1.5	1.5	11.5	-0.9	1.5	9.9	9.9
	1.3	10.0	1.5	8.7	11.4	11.4	12.9	1.6	1.6	11.5	-0.6	1.4	9.9	9.9
5/24	1.3	10.1	1.5	7.7	11.2	12.8	12.7	1.5	1.5	11.7	-0.6	1.5	9.7	9.3
	1.3	10.0	1.6	7.4	11.8	12.0	12.4	1.5	1.5	11.6	-0.8	1.6	9.8	9.4
								1.5	1.5	11.6				
5/25	1.3	10.2	1.4	8.2	12.1	10.3	13.2	1.5	1.5	11.4	-0.4	1.5	9.9	9.9
	1.4	10.1	1.6	7.4	11.8	12.0	12.4	1.4	1.4	11.5	-0.5	1.5	10.1	9.4
5/26	1.3	10.2	1.4	8.2	11.7	10.1	13.2	1.6	1.6	11.5	-1.3	1.5	10.1	9.4
	1.4	10.1	1.5	7.9	11.4	12.8	12.9	1.4	1.4	12.0	-1.6	1.5	10.0	9.2
5/27	1.4	10.1	1.5	8.1	11.6	13.0	13.1	1.4	1.4	11.9	-1.6	1.5	10.1	9.3
	1.3	10.1	1.4	8.1	11.6	13.0	13.1	1.5	1.5	11.9	-1.8	1.4	10.3	9.4
5/28														
	1.3	10.1	1.6	7.6	11.1	12.5	12.6	1.3	1.3	11.9	-1.5	1.6	10.0	9.1
	1.3	10.1	1.4	8.2	11.7	13.1	13.2	1.5	1.5	11.9	-1.5	1.5	10.1	9.3
_,								1.5	1.5	12.4				
5/29	1.4	10.1	1.3	8.7	11.9	13.5	12.8	1.2	1.2	12.1	-1.9	1.6	9.8	8.9
	1.3	10.3	1.5	8.7	11.7	13.3	12.8	1.3	1.3	11.9	-1.8	1.5	10.1	9.1
AVG:	1.3	10.1	1.5	8.1	11.6	12.2	12.9	1.5	1.5	11.8	-1.2	1.5	10.0	9.4

Fishways are inspected twice daily. Overnight trend monitored via Old SCADA.



Sturgeons in the east ladder transportation channel chasing adult shad. 5/26/2021

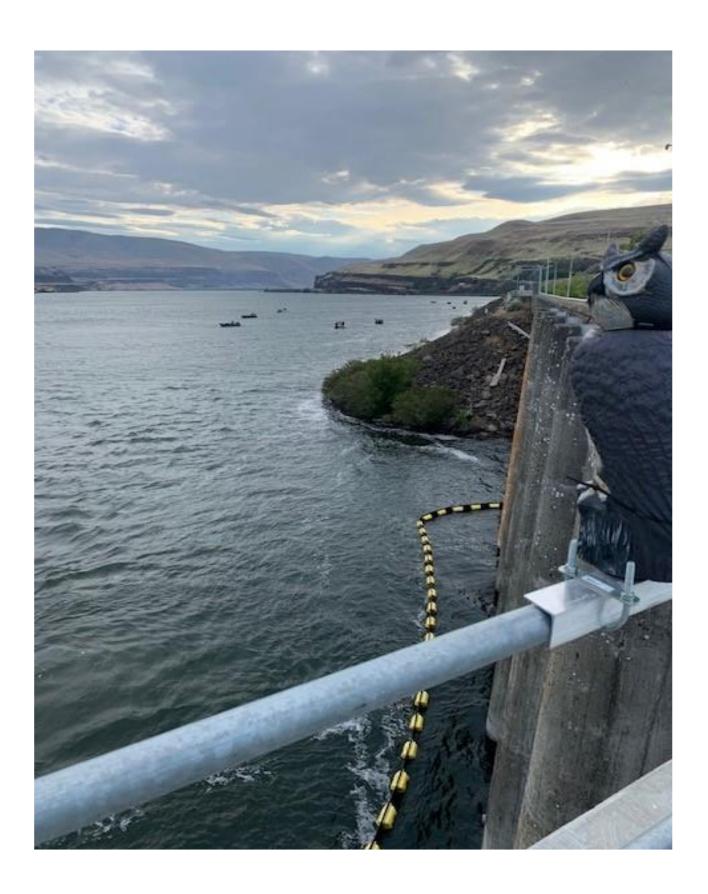

Unhappy sport fishers behaving. Staying greater than 200' from east exit.