CENWP-OD-B 05 July 2015

MEMORANDUM FOR Biologist, Operations Division (CENWP-OD)

SUBJECT: Bonneville Project, Fishway and Fish Activities for <u>Week 27</u> of 2015, which covers the period from <u>28 June – 04 July 2015.</u>

1. OPERATION SUMMARY:

- a. Daily average river flows ranged from 137.3 to 157.3 kcfs. Daily average powerhouse forebay elevation ranged from 74.0 to 74.6 msl. Daily average project tailwater ranged from 12.9 to 14.0 msl. Secchi disk measurements ranged from 6.0' to 7.0' or greater. Daily average water temperature ranged from 71 to 73°F this week.
- b. Summer spill started on 16 June. Daily average spill ranged from 88.4 to 100.3 kcfs.
- c. Unit Operation. Powerhouse two remains the priority powerhouse. Main unit draw downs are measured every Monday and more frequently as needed.
 - (1) Table 1. Unit Outages. No units were out of service this week.
- d. Fish Units. Second Powerhouse fish units provide attraction flow for the Washington Shore (WS) fish ladder. From 01 June 31 August, units may be placed in standby or the output reduced during nighttime spill hours to reduce entrance velocities for lamprey.

(1) Table 2. Fish unit drawdowns, in feet.

| ,, | | | | | | |
|------|-----|-----|--|--|--|--|
| Date | F1 | F2 | | | | |
| 6/28 | 0.2 | 0.6 | | | | |
| 6/29 | | | | | | |
| 6/30 | 0.3 | - | | | | |
| 7/1 | 0.3 | 0.2 | | | | |
| 7/2 | 0.3 | 0.1 | | | | |
| 7/3 | 0.1 | 0.3 | | | | |
| 7/4 | 0.3 | 0.2 | | | | |

2. ACTIVITIES:

- a. <u>Auxiliary Water System Closures</u>. No closures occurred this week.
- b. STS/VBS inspections. No inspection occurred this week.

c. Dewatering and Fish Salvage. No dewaterings occurred this week.

3. RESEARCH:

- a. $\underline{CRITFC AFF}$. High-temperature (>70°F) sampling was initiated on 30 June; no sampling occurred 28 29 June.
 - b. Normandeau Fish Counting. Visual counting continues.
- c. <u>PSMFC Smolt Monitoring Program.</u> Juvenile fish condition and index monitoring continues. No research fish were collected this week. SbyC is active for NOAA and USFWS. High-temperature sampling protocols were initiated on 28 June. Gas Bubble Trauma (GBT) evaluations began 25 April. This week's results: 184 subyearling Chinook examined with no GBT symptoms. These fallbacks were recorded crossing the separator bars: 1 steelhead. More details can be found on the <u>FPC webpage</u>.
 - d. <u>USDA Sea lion and avian hazing</u>. Land-based hazing began on 18 March.

4. FISHWAYS:

- a. Project biologists inspected 28 June 04 July.
- b. Fish passage plan observations.
 - (1) Table 3. FPP out of criteria items.

| Date Location FPP Items Cause Respon | | | | | | | |
|--|--|--|--|--|--|--|--|
| BRADFORD ISLAND – See below | | | | | | | |
| CASCADES ISLAND | | | | | | | |
| 6/30 CI fish entrance Differential < 1.0' FV5-4 OOS See 4.1.6, below | | | | | | | |
| WASHINGTON SHORE – See below | | | | | | | |

- (2) WG-1, one of the south PH1CC entrances, experienced a gate failure on 17 November. The gate fell and the picking beam fell into the water. WG-2 has been closed to improve entrance differentials. Repairs will require the ITS to be closed and are being coordinated for August, 2015.
- (3) A-branch diffuser FG3-3 is mechanically bound. Repairs are not possible until A-branch is dewatered below tailwater during the 2015/16 winter maintenance period.
- (4) B-branch gate 4N, adjacent to the fish entrance, is broken and closed. 4S is currently open in its place.
- (5) PH2CC diffuser A2 was unable to be repaired during winter maintenance and remains closed. The gate for diffuser B5 was removed for repairs and therefore cannot


be closed.

- (6) FV5-4 was discovered to have mechanical problems on 21 April. It is currently closed and in manual. Diffusers FG3-9 through 15 are open and in manual to compensate. Repairs have been coordinated for October. See <u>15BON03</u>.
- c. <u>Fishway Temperatures</u>. Temperatures are taken from 01 March through 30 November. Forebay temperatures can be found <u>online</u>.

(1) Table 4. Daily Average Temperature in Degree Fahrenheit (°F).

| , , | | Fishways | | | | Lamprey | | | |
|------|---------|-----------|----------|------|------|---------|--------|--------|---------|
| Date | Forebay | Brad. Is. | WA shore | AFF | SMF | BI LPS | WA LPS | CI LPS | NDE LPS |
| 6/28 | 70.3 | 69.8 | 69.5 | 69.6 | 70.4 | 70.7 | 69.2 | 69.9 | 69.5 |
| 6/29 | 70.6 | 70.2 | 69.8 | 69.8 | 70.7 | 71.2 | 69.5 | 70.2 | 69.8 |
| 6/30 | 70.9 | 70.5 | 70.1 | 70.1 | 70.9 | 71.4 | 69.7 | 70.5 | 70.0 |
| 7/1 | 71.3 | 71.0 | 70.5 | 70.6 | 71.4 | 72.0 | 70.2 | 71.0 | 70.6 |
| 7/2 | 71.6 | 71.3 | 70.8 | 70.9 | 71.7 | 72.4 | 70.5 | 71.3 | 70.9 |
| 7/3 | 71.9 | 71.5 | 71.1 | 71.1 | 72.0 | 72.6 | 70.8 | 71.6 | 71.2 |
| 7/4 | 72.2 | 71.7 | 71.4 | 71.5 | 72.3 | 72.7 | 71.1 | 71.8 | 71.3 |

(2) Chart 1. Daily Average Temperature in Degree Fahrenheit (°F).

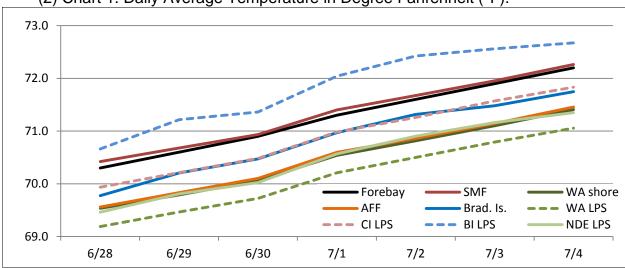

- d. <u>Zebra Mussel Monitoring</u>. No signs of colonization were observed this reporting week.
 - e. Avian Monitoring. Bird counts are made between 01 April and 31 October.

(1) Table 5. Counts of tailrace foraging piscivorous birds.

| Date | Gulls | Cormorants | Terns | Wh. Pelicans | Grebes |
|------|-------|------------|-------|--------------|--------|
| 6/28 | 0 | 10 | 0 | 0 | 0 |
| 6/29 | 0 | 3 | 0 | 0 | 0 |
| 6/30 | 0 | 5 | 0 | 0 | 0 |

| 7/1 | 1 | 2 | 0 | 0 | 0 |
|-----|---|---|---|---|---|
| 7/2 | 0 | 0 | 0 | 0 | 0 |
| 7/3 | 0 | 2 | 0 | 0 | 0 |
| 7/4 | 0 | 6 | 0 | 0 | 0 |

f. Adult Fishways.

- (1) No calibration occurred this reporting week.
- (2) 11 of 12 floating orifice gates (FOGs) are installed; one gate is out for maintenance. FOG SLEDs are installed.
 - (3) All SLEDs remain installed.
 - (4) All adult fishways were placed in shad mode on 30 May.

g. Juvenile Fishways.

- (1) The south end gate of the Ice and Trash Sluiceway (ITS) was removed for repairs. Plating has been placed over the bottom of the guide slot to minimize fish impacts. Reinstallation dates are currently being coordinated for August, 2015.
 - (2) The hydro-cannon remains in service.
 - (3) The B2CC remains open.
 - (4) The DSM remains in service.

h. Lamprey Fishways.

- (1) All LPS's remain in service.
- **5. CONSTRUCTION:** Nothing to report.
- **6. HAZMAT, SPILLS AND CLEANUP:** Nothing to report.

7. TELETYPES CURRENTLY IN EFFECT:

- a. A teletype sent on 30 March updates the spill caps and lack of load conditions to be used from 0000 on 01 April until further notice.
- b. A teletype sent on 8 April defines the spring and summer spill operations to be used from 10 April through 31 August.
- c. A teletype sent on 11 June requests that BON pool operate within a 1.5' band, hard constraint, from 16 June through 2 July during the periods and times described

within for treaty fishing.

- d. A teletype sent on 18 June requests that from 0800 to 2000 daily during 3-5 July, operate BON forebay at less than 75.0 msl, hard constraint, to expose the Hood River sand bar for recreational users.
- e. A teletype sent on 29 June requests that the BON forebay be maintained at ranges from 74.0 to 76.5 msl, hard constraint, and 75.0 to 76.5, soft constraint, for the dates and times listed within to allow sailboats to be launched and recovered on 6-9 August at the Hood River boat launch.
- f. A teletype sent on 29 June requests that the BON forebay be maintained at ranges from 74.0 to 76.5 msl, hard constraint, and 75.5 to 76.5, soft constraint, for the dates and times listed within to allow sailboats to be launched and recovered on 14-15 August at Cascade Locks and The Dalles.
- g. A teletype sent on 2 July requests that BON pool operate within a 1.5' band, hard constraint, from 0600 on 6 July to 1800 on 8 July for treaty fishing.

JERRY A. CARROLL Operations Manager Bonneville Project