

MEMORANDUM FOR Biologist, Operations Division (CENWP-OD)
 SUBJECT: Bonneville Project, Fishway and Fish Activities for Week 43 of 2018, which covers the period from 21 - 27 October.

1. OPERATION SUMMARY:

- a. Daily average river flows ranged from 77.4 to 126.3 kcfs. Daily average powerhouse forebay elevation ranged from 72.9' to 74.2' msl. Daily average project tailwater ranged from 7.3' to 11.4' msl. Secchi disk measurements stayed at or above 7.0'. Daily average water temperature ranged from 58 - 59°F.
- b. Daily average spill ranged from 0.3 to 1.2 kcfs.
- c. Unit Operation. PH2 remains the priority powerhouse. Main unit drawdowns are measured every Monday and more frequently as needed.

(1) Table 1. Main Unit Outages.

Unit	OOS Date	RTS Date	Reason
02	2118 on 24 Oct	0850 on 25 Oct	Downstream tank foot valve
13	0702 on 01 Oct	---	PO, 4 year overhaul

- d. Fish Units. Second Powerhouse fish units provide attraction flow for the Washington Shore (WS) fish ladder.

(1) Fish Unit Outages. Table 2.

Unit	OOS Date	RTS Date	Reason
F2	0949 on 21 Oct	0744 on 22 Oct	RS
F2	0158 on 23 Oct	0205 on 23 Oct	RS

- e. Table 3. Fish unit drawdowns, in feet.

Date	F1	F2
10/21	--	--
10/22	0.2'	0.3'
10/23	0.5'	0.5'
10/24	--	--
10/25	--	--
10/26	0.7'	1.0'
10/27	0.4'	0.7'

2. MAINTENANCE ACTIVITIES:

a. Auxiliary Water System Closures.

(1) FV1-1 was closed for cleaning from 0749 to 0818 on 22 October.

(2) FV3-7 was closed for cleaning from 1511 to 1540 on 25 October.

(3) FV3-9 was closed for cleaning from 1511 to 1540 on 25 October.

(4) FV5-3 and 5-4 were closed for a hydrosurvey from 1030 to 1230 on 24 October.

(5) FV4-3 and 4-4 were closed for a hydrosurvey from 1230 to 1340 on 24 October.

b. STS/VBS Inspections. Nothing to report.

c. Dewatering and Fish Salvages. Nothing to report.

3. RESEARCH:

a. Normandeau – Fish counting. Daytime visual counting (0500 to 2100) began on 01 April. Fish counts can be viewed [here](#).

b. PSMFC – Smolt Monitoring. Sample collections at the Smolt Monitoring Facility began at 0700 on 02 March. Debris at the PDS and fish/debris separator was light to moderate consisting mostly of filamentous algae, aquatic macrophytes, sticks, and dead adult shad. GBT monitoring activities have concluded for the season. Please follow this [link](#) to the FPC web page for further details. Truck releases of summer/fall out-migrants originating from Snake River dams began on 16 August and are scheduled to occur every other day. Fallbacks observed this week: 7 salmon and 2 unknown salmonids. No fish were collected for research this week.

c. University of Idaho. Evaluation of adult Pacific Lamprey passage behavior in relation to lower Columbia River dam modifications, AFEP Study Code LMP-P-17-1 began on 11 May. Tagging operations concluded on 14 September.

4. FISHWAYS:

- a. Project biologists inspected from 21-27 October.
- b. Fish passage plan observations.

(1) Table 4. FPP out of criteria items.

Date	Location	FPP Violation	Cause	Response
Bradford Island				
10/21-22,24	A-Branch	Differential > 1.1'	Unknown	NA
Cascades Island				
10/23	CI Entrance	Differential < 1.0'	FG6-11/12	Ops Adjusted
Washington Shore				
10/21	Weir 38	Differential < 0.9'	Unknown	NA

- (2) Bonneville had the majority of its avian lines broken due to ice storms during the 2016/17 winter. All zones had been installed besides PH2. PH2 lines are awaiting installation. Numerous lines have since been broken again by high flows and debris at Cascades Island and Spillway locations.
- (3) PH2 diffuser B4 was discovered to have its stem bent on 24 May 2017. This likely occurred while trying to close and the valve is believed to be open. It should be closed at tailwaters above 31.0' and below 11.0' msl.
- (4) On 01 May, FG6-11 was found broken partially open. The diffuser shaft had broken away from the motor. Due to the subsidence issues at Cascades Island, repairs cannot occur until crane support is allowed in the vicinity.
- (5) The South Downstream Entrance (SDE) and North Downstream Entrance (NDE) gates will not lower past 4' and 6', respectively. It is believed the gates pits are obstructed with sediment. They will be addressed during the winter maintenance period.
- (6) On 18 August, FG6-12 was found to be mechanically bound in the open position. FG6-12 should only be open with tailwaters ranging from 11.0'-33.0'. Due to the subsidence issues at Cascades Island, repairs cannot occur until crane support is allowed in the vicinity.
- (7) Weir gates 2 and 64 have been unable to maintain submergence level criteria when tailwaters are below 11.0' msl. This is due to the minimum elevations of 3.1' for WG-2 and 2.8' for WG-64.

c. Adult Fishways.

- (1) The AFF remains in service.
- (2) Sensor calibration occurred on 26 October.
- (3) SLEDs are installed at all entrances.

d. Juvenile Fishways.

- (1) The ITS remains in service.
- (2) The hydro-cannon remains in service.
- (3) The B2CC remains closed.
- (4) The DSM remains in service.
- (5) STSs are installed.

e. Lamprey Fishways.

- (1) The Bradford Island, Cascades Island, and WA Shore AWS LPSs remain in service.
- (2) The NDE Lamprey Flume Structure (LFS) was taken out of service on 14 September.
- (3) AFF lamprey trap was taken out of service on 14 September.
- (4) The Bradford Island Lamprey Wetted Wall taken out of service on 10 September.

f. Avian Monitoring. Avian counts are recorded 01 April – 31 October.

(1) Table 5. Avian Counts.

Date	Gulls	Cormorants	Terns	Wh. Pelicans	Grebes
10/21	---	---	0	0	0
10/22	12	6	0	0	0
10/23	---	---	0	0	0
10/24	10	134	0	0	0
10/5	20	148	0	0	0
10/26	13	135	0	0	0
10/27	28	144	0	0	0


5. WATER QUALITY MONITORING:

a. Fishway Temperatures. Temperatures are taken from 01 March through 30 November.

(1) Table 6. Average daily fishway water temperatures (Fahrenheit).

Date	A-Branch	B-Branch	BI Exit	WA Shore	AFF	SMF	BI LPS	CI LPS	WA AWS LPS
21-Oct	59.2	58.9	58.9	57.9	58.8	59.1	59.2	59.1	59.2
22-Oct	59.0	58.6	58.6	57.6	58.6	58.8	58.8	58.9	59.0
23-Oct	58.9	58.5	58.5	57.5	58.5	58.7	58.8	58.7	58.9
24-Oct	59.2	58.8	58.8	57.8	58.8	59.0	59.1	59.1	59.2
25-Oct	59.1	58.8	58.9	57.8	58.8	58.9	59.1	59.0	59.1
26-Oct	59.1	58.8	58.9	57.7	58.7	58.9	59.1	59.0	59.1
27-Oct	59.0	58.7	58.8	57.7	58.7	58.8	59.0	59.0	59.0

Figure 1. Graph of fishway water temperatures (Fahrenheit).

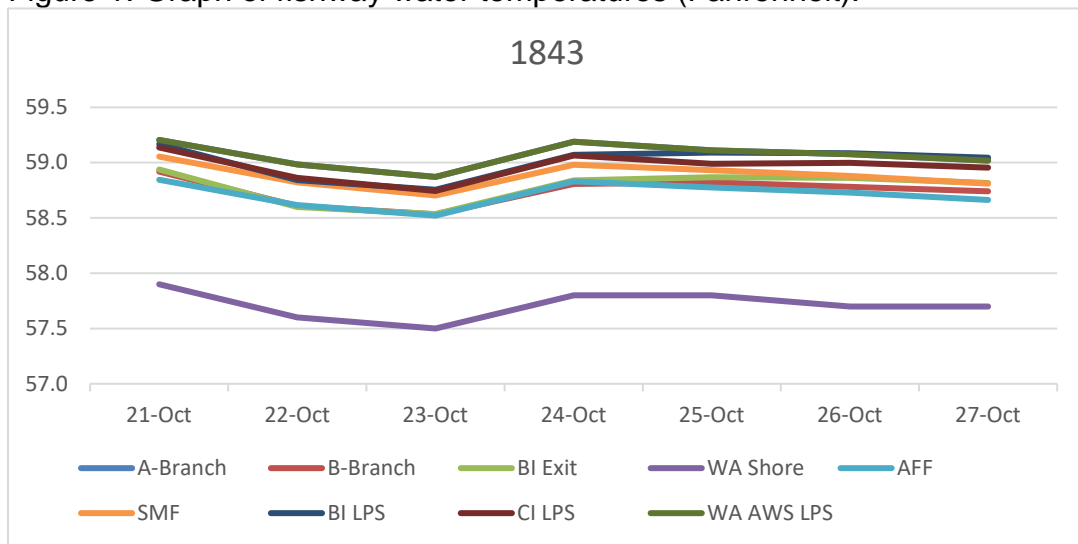

b. Zebra Mussel Monitoring. No signs of colonization were observed this reporting week.

6. CONSTRUCTION: Nothing to report.

7. HAZMAT, SPILLS AND CLEANUP: Nothing to report.

8. TELETYPES CURRENTLY IN EFFECT:

- a. A teletype sent on 30 August outlines the wintertime spill priority list and wintertime spill caps for all Columbia Basin projects and BPA.
- b. A teletype sent on 22 October outlines a spillway outage for a hydrosurvey to be conducted from ~0700 until 1600 on 24 October.
- c. A teletype sent on 22 October updates the previous teletype in regards to the outage for the hydrosurvey.

MICHAEL ADAMS, P.E.
Operations Manager
Bonneville Project