The Dalles Dam Fishway Status Report

11/26/23

Inspection Period 11/19-11/25, 2023

THE DALLES DAM



The Dalles Project-Fisheries P.O. Box 564
The Dalles, OR 97058-9998
Phone: 541-506-3800

The Dalles Dam	Inspections	Criteria	Total Number of Insp		14	Temperature:	51.7				
The Danes Dani	000	Limit	Comments:				Weekly Ave. Secchi: 5.0+				
			NORTH FIS	SHWA	Υ						
Exit differential	0	≤ 0.5'									
Count station differential	0	≤ 0.3'									
Veir crest depth	0	1.0' ± 0.1'									
Intrance weir N1	0	depth (≥ 8')	Average for the week	9.4							
ntrance Differential	0	1.0' - 2.0'	Average for the week	1.3							
N2		Closed									
PUD Intake differential	0	≤ 0.5'									
			EAST FIS	HWA'	<u> </u>						
xit differential	0	≤ 0.5'									
Removable weirs 154-157	0	Per forebay									
Veir 158-159 differential	0	1.1' ± 0.1'									
Count station differential	0	≤ 0.3'									
53 Weir crest depth	0	1' ± 0.1'	1.2' per FPP.								
unction pool weir JP6	0	> 7.0'	Weekly average	10.4							
ast entrance differential	0	1.0' - 2.0'	Weekly average	1.5							
Intrance weir E1	0	No criteria	Weekly average	1.4							
Entrance weir E2	0	depth (≥ 8')	Weekly average	11.0							
ntrance weir E3	0	depth (≥ 8')	Weekly average	11.0							
Collection channel velocity	0	1.5 - 4 fps	1.13fps west 10/18/23								
ransportation channel velocity	0	1.5 - 4 fps	East 3.84fps 10/18/23								
North channel velocity	0	1.5 - 4 fps	3.51 fps 10/26/23								
South entrance	0	1.5 - 4 fps	3.39 fps 10/27/23								
Vest entrance differential	0	1.0' - 2.0'	Weekly average	1.3							
Intrance weir W1	0	depth (≥ 8')	Weekly average	9.0							
Intrance weir W2	1	depth (≥ 8')	Weekly average	8.4							
Intrance weir W3	0	No criteria	Weekly average	-2.3							
South entrance differential	0	1.0' - 2.0'	Weekly average	1.3							
Entrance weir S1	0	depth (≥ 8')	Weekly average	9.0							
Intrance weir S2	0	depth (≥ 8')	Weekly average	8.8							
			JUVENILE E	SYPAS	SS						
Sluicegate operation	0		1-8-18 gates open.								
urbine trashrack drawdown	0		11/3/23 all in criteria								
Spill volume/pattern	0	1 to 22	Spill closed								
urbine Unit Priority	0	per FPP									
Gatewells	0	Weekly	11/3/23, No fish or mo	rtality.							

Current Outages

MU4 OOS 04/17/2023 0630 – 1/18/2024 1700, BREAKER REPAIR/REPLACEMENT MU19 & MU20 FOOS 10/07/2018 1205 – 10/31/2025 1700 T10 ACETYLENE

SS02 OOS 11/27/23 0700 - 12/7/23 1700 - 2vr

MU03/MU04 OOS 11/27/2023 0800 - 12/03/2023 1800, BPA LIMITS LINE 2 TO 0MW

Maintenance

Planning spill gates 9 and 10 cable and gearbox swap. Possible this fall/winter.

Spillway assessment; Spillgates 1-9 rehab 2034. Spillway crane replace first priority. Reviewing gate operation frequency.

Starting contractor lamprey entrance weir mods and trap above water line work. In house 156 157 exit orifice cut this winter.

Winter work plans; select wier motor/brake replace, 158/9 weir reseal, swap south weir gearboxes

Predators

Northern Pikeminnow Management Program concluded with 2421 fish removed from project

Bird Gard sound system being tested at peninsula and east entrance. Appears effective on cormorants and feeding gulls.

Trial of Tori lines installed at south and west entrances ongoing.

140-250~ WEGU/CAGU gulls on project, mergansers present and 70 some cormorant no longer foraging at east entrances.

Foxpro distress caller appears effective at dispersing gulls feeding when employed daily in PH2 and navlock. On/off testing continues.

Research/Construction/Contractors

USGS temperature link- November

4 Peaks fish count ending 10/31

Supporting lamprey improvements PDT. Two of 4 exit weir modified with lamprey orifice, other 2 this winter.

Planning for install of junction pool lamprey trap and entrance weir modifications via contractor this winter.

zebra/quagga mussel samples collected on 10/22/2023, no mussels on substrate. No veligers detected in August samples.

PTAGIS fishladder data collection at count stations continues


Operations

Sluice gates 1-1, 1-2, 1-3, 8-1, 8-3, 18-2 in operation

Fish unit flow reduced from 5kcfs to 4 kcfs rest of season due to grating damage repair.

Approved by: Ron Twiner, Operation Project Manager, The Dalles Dam


Bird Count Zones, Avian Lines and Deterrent Sites

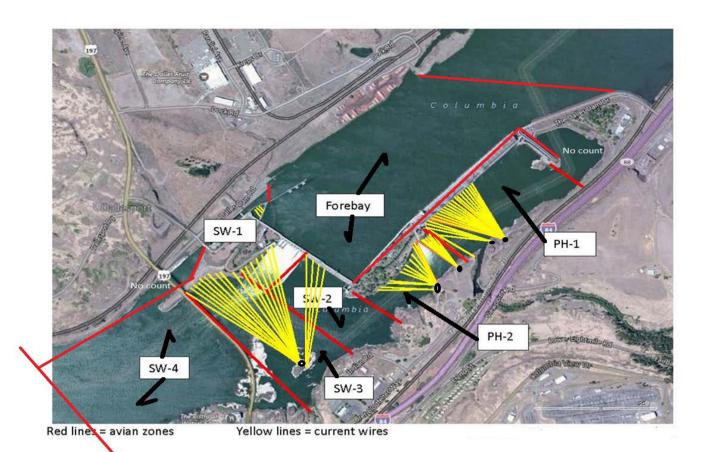


Avian predator tori lines and audio distress Bird Gard. 10/2023

Tori lines at East Ladder entrances.

Bird Gard audio deterrent.

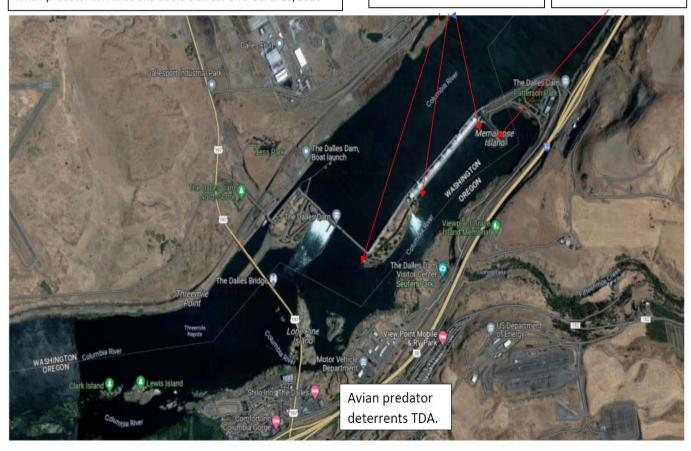

Avian Count at TDA, 11/19 to 11/25/2023

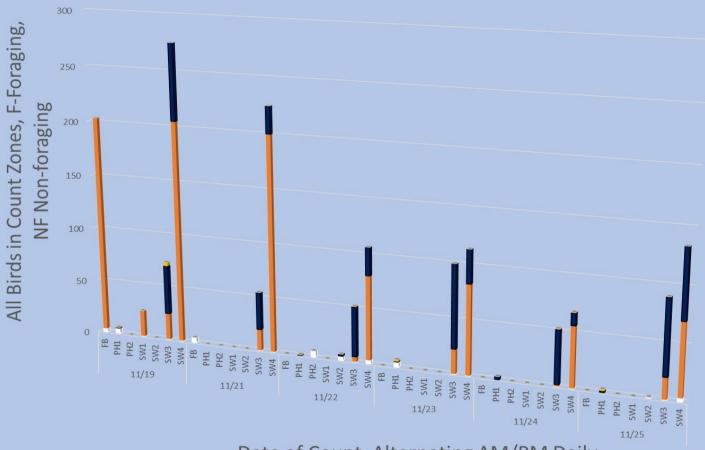


Date of Count, Alternating AM/PM Daily

Values

Sum of AWPE NF
Sum of AWPE F

■ Sum of DCCO F
■ Sum of DCCO NF
■ Sum of GULL NF

Sum of GULL F

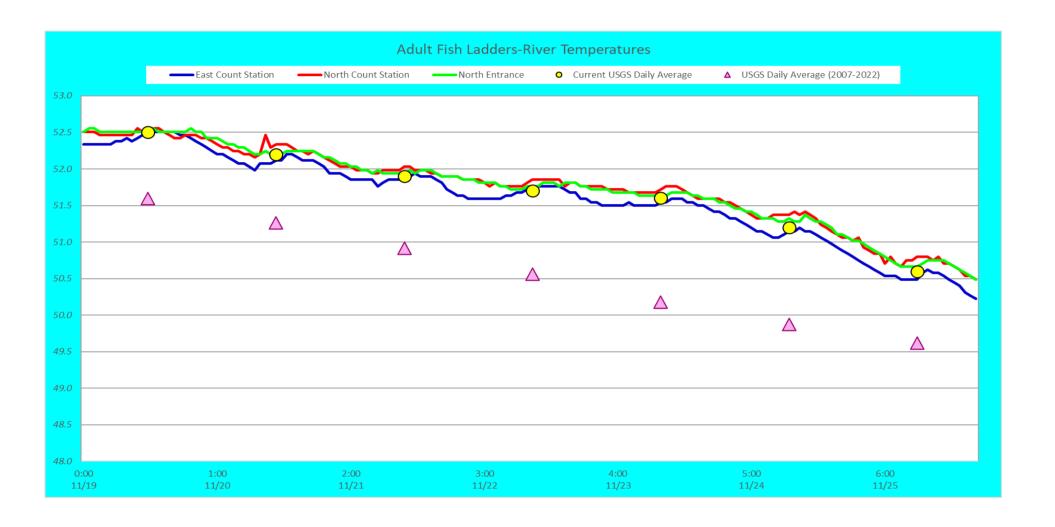

Secchi:		USGS			
5.0+	Sun	52.5			
5.0+	Mon	52.2			
5.0+	Tue	51.9			
5.0+	Wed	51.7			
5.0+	Thurs	51.6			
5.0+	Fri	51.2			
5.0+	Sat	50.6			
5.0+	AVG	51.7			

Reporting week data

Date:	North Ladder		East Ladder											
			East Entrance				West Entrance				South Entrance			
	Differential	N1 Depth	Differential	E1 Depth	E2 Depth	E3 Depth	JP 6	Differential	W1	W2	W3	Differential	S1	S2
11/19	1.2	9.3	1.7	2.4	9.9	9.9	11.4	1.4	9.3	9.3	-1.6	1.3	9.1	9.0
	1.1	9.5	1.6	1.4	11.0	11.1	10.4	1.4	8.8	-2.2	-2.3	1.4	8.6	8.4
11/20														
	1.3	9.5	1.4	1.3	10.9	10.9	10.3	1.3	9.2	9.3	-2.7	1.3	9.2	9.0
	1.3	9.4	1.6	1.0	10.6	10.6	10.0	1.3	9.1	9.2	-0.1	1.4	9.0	8.7
11/21	1.3	8.6	1.4	1.7	10.9	10.9	10.7	1.2	9.2	9.4	-2.3	1.3	9.3	9.2
	1.5	9.3	1.6	1.2	10.4	10.3	10.2	1.3	9.2	9.4	-2.8	1.3	9.0	8.8
11/22														
	1.4	9.4	1.4	1.3	11.1	11.1	10.3	1.3	8.8	9.0	-2.6	1.3	9.3	8.7
	1.3	9.4	1.6	0.8	10.9	10.9	9.8	1.2	9.0	9.3	-2.8	1.3	9.0	8.8
11/23														
	1.3	9.5	1.5	1.2	11.3	11.3	10.2	1.3	9.0	9.2	-2.5	1.2	9.0	9.0
	1.4	9.5	1.4	1.3	11.4	11.4	10.3	1.3	8.8	9.0	-2.5	1.3	9.3	8.9
11/24														
	1.5	9.5	1.4	1.5	11.6	11.6	10.5	1.2	9.0	9.3	-2.4	1.3	8.9	8.8
	1.3	9.6	1.4	1.5	11.6	11.6	10.5	1.3	8.8	9.0	-2.3	1.3	9.1	9.0
11/25	1.4	9.4	1.5	1.3	11.2	11.2	10.3	1.4	8.6	8.8	-2.5	1.4	8.6	8.6
	1.4	9.5	1.5	1.6	11.5	11.4	10.6	1.3	8.8	9.1	-2.2	1.3	8.9	8.9
AVG:	1.3	9.4	1.5	1.4	11.0	11.0	10.4	1.3	9.0	8.4	-2.3	1.3	9.0	8.8

Fishways inspected twice daily

