CENWP-OD-B 30 August 2015

MEMORANDUM FOR Biologist, Operations Division (CENWP-OD)

SUBJECT: Bonneville Project, Fishway and Fish Activities for <u>Week 35</u> of 2015, which covers the period from 23 – 29 August 2015.

1. OPERATION SUMMARY:

- a. Daily average river flows ranged from 139.9 to 152.7 kcfs. Daily average powerhouse forebay elevation ranged from 75.5 to 76.2 msl. Daily average project tailwater ranged from 12.7 to 13.6 msl. Secchi disk measurements remained at 7.0' or greater. Daily average water temperature ranged from 70 to 72°F this week.
- b. Summer spill started on 16 June. Daily average spill ranged from 89.2 to 96.2 kcfs.
- c. Unit Operation. Powerhouse two remains the priority powerhouse. Main unit draw downs are measured every Monday and more frequently as needed.
 - (1) Table 1. Unit Outages.

Unit	OOS Date	RTS Date	Reason
7	0943 on 29 Jul		5-year overhaul
8	0904 on 15 Aug		Annual maint, servo, bank 7/8

- d. Fish Units. Second Powerhouse fish units provide attraction flow for the Washington Shore (WS) fish ladder. From 01 June 31 August, units may be placed in standby or the output reduced during nighttime spill hours to reduce entrance velocities for lamprey.
- (1) F1 was placed in standby to float trash from 2208 on 25 Aug until 0358 on 26 Aug. F2 was already in standby for lamprey operations.
 - (2) Table 2. Fish unit drawdowns, in feet.

Date	F1	F2
8/23	0.2	6.5
8/24	0.3	0.6
8/25	3.4	0.4
8/26		
8/27	0.4	0.2
8/28	0.6	0.3
8/29	0.1	0.3

2. ACTIVITIES:

- a. Auxiliary Water System Closures.
- (1) FV1-1 was closed for cleaning from 1353 to 1509 on 24 August.
- b. <u>STS/VBS inspections</u>. No inspections occurred this week.
- c. Dewatering and Fish Salvages. None

3. RESEARCH:

- a. $\underline{\mathsf{CRITFC}} \underline{\mathsf{AFF}}$. Modified high temperature sampling continues. On 25 27 August river temperatures dropped below 70° to allow a normal sampling regime.
 - b. Normandeau Fish Counting. Visual counting continues.
- c. <u>PSMFC Smolt Monitoring Program.</u> Juvenile fish condition and index monitoring continues. No research fish were collected this week. High-temperature sampling protocols were initiated on 28 June. Gas Bubble Trauma (GBT) evaluations began 21 April; due to high temps GBT sampling has been reduced to once a week. This week's results: not enough fish available for sufficient analysis. GBT analysis has now concluded for the season. No fallbacks were recorded crossing the separator bars. More details can be found on the FPC web page.

4. FISHWAYS:

- a. Project biologists inspected 23 29 August.
- b. Fish passage plan observations.
 - (1) Table 3. FPP out of criteria items.

Date	Location	FPP Items	Cause	Response			
BRADFORD ISLAND – See below							
8/27-29	A-branch	Water over weir > 1.1'	FV3-7 conduit leak	None			
CASCADES ISLAND – See below							
8/25	CI entrance	Entr differential < 1.0'	FV5-4 OOS	See 4.b.6			
WASHINGTON SHORE – See below							


- (2) WG-1, one of the south PH1CC entrances, experienced a gate failure on 17 November. Divers recovered the gate's picking beam on 04 August. Repairs on ongoing. The gate is estimated to return to service fall 2015.
- (3) A-branch diffuser FG3-3 is mechanically bound. Repairs are not possible until A-branch is dewatered below tailwater during the 2015/16 winter maintenance period.

- (4) B-branch gate 4N, adjacent to the fish entrance, had a bad motor. It was removed on 27 July and has been repaired. It's waiting reinstallation, likely to occur during the 2015/16 winter maintenance. 4N is closed and 4S is open in its place.
- (5) PH2CC diffuser A2 was unable to be repaired during winter maintenance and remains closed. The gate for diffuser B5 was removed for repairs and therefore cannot be closed.
- (6) FV5-4 was discovered to have mechanical problems on 21 April. It is currently closed and in manual. Diffusers FG3-9 through 15 are open and in manual to compensate. Repairs have been coordinated for October. See <u>15BON03</u>.
- c. <u>Fishway Temperatures</u>. Temperatures are taken from 01 March through 30 November. Forebay temperatures can be found <u>online</u>.

(1) Table 4. Daily Average Temperature in Degree Fahrenheit (°F).

		Fishways			Lamprey				
Date	Forebay	Brad. Is.	WA shore	AFF	SMF	BI LPS	WA LPS	CI LPS	NDE LPS
8/23	70.0	69.4	69.3	69.3	70.2	70.1	68.8	69.6	69.1
8/24	69.9	69.2	69.1	69.1	70.0	69.8	68.6	69.4	68.8
8/25	69.8	69.2	69.0	69.1	70.0	69.8	68.6	69.3	68.7
8/26	69.9	69.3	69.1	69.1	70.1	69.9	68.7	69.5	68.9
8/27	70.4	69.7	69.6	69.6	70.5	70.4	69.2	70.0	69.4
8/28	70.5	70.0	69.7	69.7	70.7	70.5	69.3	70.1	69.5
8/29	70.5	69.9	69.7	69.7	70.7	70.4	69.3	69.9	69.3

(2) Chart 1. Daily Average Temperature in Degree Fahrenheit (°F).

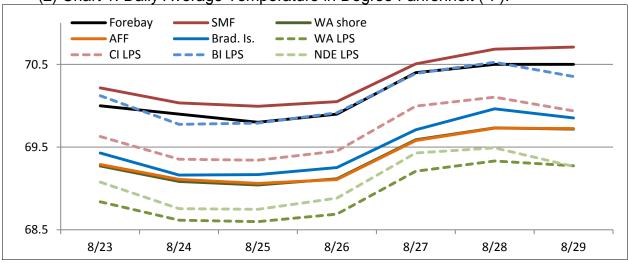

d. <u>Zebra Mussel Monitoring</u>. No signs of colonization were observed this reporting week.

- e. Avian Monitoring. Bird counts are made between 01 April and 31 October.
 - (1) Table 5. Counts of tailrace foraging piscivorous birds.

Date	Gulls	Cormorants	Terns	Wh. Pelicans	Grebes
8/23	0	1	0	0	0
8/24	0	6	0	0	0
8/25	0	12	0	0	0
8/26	0	29	0	0	0
8/27	0	0	0	0	4
8/28	0	1	0	0	0
8/29	26	0	0	0	0

f. Adult Fishways.

- (1) Calibration occurred on 28 August.
- (2) 11 of 12 floating orifice gates (FOGs) are installed; one gate is out for maintenance. FOG SLEDs are installed.
 - (3) All SLEDs are removed.
- (4) All fishways are in salmon mode except for the Cascade Island ladder, which is in shad mode to provide extra water to the CI entrance until FV5-4 is repaired. See 15BON03.
 - g. <u>Juvenile Fishways</u>.
 - (1) The ITS remains in service.
 - (2) The hydro-cannon remains in service.
 - (3) The B2CC remains open.
 - (4) The DSM remains in service.
 - h. Lamprey Fishways.
 - (1) All LPS's remain in service.
- **5. CONSTRUCTION:** Nothing to report.
- **6. HAZMAT, SPILLS AND CLEANUP:** Nothing to report.
- 7. TELETYPES CURRENTLY IN EFFECT:
 - a. A teletype sent on 30 March updates the spill caps and lack of load conditions to

be used from 0000 on 01 April until further notice.

- b. A teletype sent on 8 April defines the spring and summer spill operations to be used from 10 April through 31 August.
- c. A teletype sent on 13 August requests that BON pool operate within a 1.5' band, hard constraint, from 7 August through 12 September for the periods and times listed within for treaty fishing.
- d. A teletype sent on 18 August requests that BON pool be maintained above 75.0', hard constraint, from 1000 to 1600 on 22 23 August for paddle boarding in Hood River.

JERRY A. CARROLL Operations Manager Bonneville Project