

MEMORANDUM FOR Biologist, Operations Division (CENWP-OD)
 SUBJECT: Bonneville Project, Fishway and Fish Activities for Week 24 of 2018, which covers the period from 10 - 16 June.

1. OPERATION SUMMARY:

- a. Daily average river flows ranged from 221.3 to 301.0 kcfs. Daily average powerhouse forebay elevation ranged from 73.3' to 74.4' msl. Daily average project tailwater ranged from 18.0' to 22.1' msl. Secchi disk measurements ranged from 3.0' to 5.0'. Daily average water temperature ranged from 60°F - 61°F.
- b. Daily average spill ranged from 95.8 to 121.4 kcfs.
- c. Unit Operation. PH2 remains the priority powerhouse. Main unit drawdowns are measured every Monday and more frequently as needed.

(1) Table 1. Unit Outages.

Unit	OOS Date	RTS Date	Reason
07	0922 on 05 Apr	---	FO, Underrated Disconnect
08	0921 on 05 Apr	---	FO, Underrated Disconnect
09	0000 on 11 June	1252 on 14 June	PO, Annual
14	0001 on 11 June	2035 on 14 June	PO, Annual
18	0701 on 13 June	1043 on 13 June	PO, STS Repair

- d. Fish Units. Second Powerhouse fish units provide attraction flow for the Washington Shore (WS) fish ladder.

(1) F2 goes into RS nightly from 2200-0400 for regular spill season PH2 Lamprey ops (per FPP 2.4.2.13.c.).

- e. Table 2. Fish unit drawdowns, in feet.

Date	F1	F2
6/10	0.2'	0.5'
6/11	0.2'	0.6'
6/12	0.2'	0.6'
6/13	0.2'	0.3'
6/14	0.2'	0.6'
6/15	0.2'	0.6'
6/16	0.2'	0.7'

2. MAINTENANCE ACTIVITIES:

f. Auxiliary Water System Closures.

(1) FV3-7 was closed from 0737 to 0747 on 11 June for cleaning.

(2) FV3-9 was closed from 0737 to 0747 on 11 June for cleaning.

g. STS/VBS Inspections.

UNIT #	PREVIOUS STS HRS	HRS WHEN INSPECTED	STS-A	STS-B	STS-C	VBS A,B,C	HRS RUN	REMARKS
11	37831	38453	Ok	Ok	Ok	Ok	622	n/a
12	28152	28775	OK	OK	OK	OK	623	n/a
13	99843	00273	OK	OK	OK	OK	430	n/a
14	01961	02577	OK	OK	OK	OK	616	n/a
15	14073	14697	OK	OK	OK	OK	624	n/a
16	26257	26882	OK	Ok	Ok	OK	625	n/a
17	18014	18638	OK	OK	OK	OK	624	n/a
18	56477	57092	OK	OK	OK	OK	615	n/a

h. Dewatering and Fish Salvages. Nothing to report.

2. RESEARCH:

a. Normandeau – Fish counting. Daytime visual counting (0500 to 2100) began on 01 April. Nighttime video recording (2100-0500) began on 15 May. Fish counts can be viewed [here](#).

b. PSMFC – Smolt Monitoring. Sample collections at the SMF began at 0700 on 02 March. Debris at the primary dewatering structure (PDS) and fish/debris separator was light to moderate consisting mostly of woody “mulch-like” debris and a few sticks. Gas Bubble Trauma (GBT) examinations began on 15 April and are typically performed two days per week through the end of spill. Results of this week’s Gas Bubble Trauma (GBT) examinations: 200 yearling Chinook and subyearling Chinook, and steelhead examined: no GBT symptoms observed. Fallbacks observed this week: 3 steelhead, 8 salmon and 1 unknown salmonid. Separation by Code is active for NOAA studies (Marsh). Please follow this [link](#) to the FPC web page for further details.

c. USDA – Avian hazing. Avian deck-based hazing began on 01 April.

d. CRITFC – Adult Salmonid Sampling. Adult salmonid sampling in the adult fish facility (AFF) began on 25 April and occurs 5 days per week.

- e. University of Idaho. Evaluation of adult Pacific Lamprey passage behavior in relation to lower Columbia River dam modifications, AFEP Study Code LMP-P-17-1 began on 11 May.
- f. NOAA – Northwest Fisheries Science Center (Frick). Development and evaluation of an adult lamprey wetted wall structure at Bradford Island Fishway 2017-2019 began on 08 May.
- g. NOAA – Northwest Fisheries Science Center (Marsh). Sort by Code (SbyC) recapture and collection of biological data from wild yearling Chinook Salmon, and both hatchery and wild juvenile Steelhead Trout are conducted at Bonneville’s SMF.
- a. USFWS – Lower Columbia River Fish Health Center. Adult and juvenile American Shad will be collected from the project as part of the annual National Wild Fish Health Survey. BON mortalities will also be sent to the USFWS for pathogen analysis and potential causes of death.

3. FISHWAYS:

- a. Bradford Island went into Shad Mode on 27 May.
- b. Washington Shore went into Shad Mode on 09 June.
- c. Project biologists inspected from 10 – 16 June.
- d. Fish passage plan observations.

(1) Table 3. FPP out of criteria items.

Date	Location	FPP Violation	Cause	Response
Bradford Island				
6/16	B-Branch Entrance	Differential > FPP	Unknown	NA
Cascades Island - Nothing to Report.				
Washington Shore				

- (2) SLEDS are still installed at all fishway entrances, per part iii, of section 2.4.2.11 of the FPP, as sea lions were still present at Bonn.
- (3) B-Branch North Entrance Gate is to open at tailwater below 17’. The mechanism is broken, and does not operate. It is awaiting repair.
- (4) On 01 May, FG6-11 was found broken partially open. The diffuser shaft had broken away from the motor. Due to the subsidence issues at Cascades Island, repairs can not occur until crane support is allowed in the vicinity.

(5) Bonneville had the majority of its avian lines broken due to ice storms during the 2016/17 winter. Avian lines began replacement on 19 March. All zones had been installed besides PH2. PH2 lines are awaiting installation pending material procurement. Numerous lines have since been broken again by high flows and debris at CI and Spillway locations.

(6) PH2 diffuser B4 was discovered to have its stem bent on 24 May 2017. This likely occurred while trying to close and the valve is believed to be open. It should be closed at tailwaters above 31.0' and below 11.0' msl.

c. Adult Fishways.

(1) The AFF remains in service.

(2) Sensor calibration check was conducted on 10 June.

(3) SLEDs are installed at all entrances.

d. Juvenile Fishways.

(1) The ITS remains in service.

(2) The hydro-cannon remains in service.

(3) The B2CC remains in service.

(4) The DSM remains in service.

(5) STSs are installed.

e. Lamprey Fishways.

(1) The Bradford Island, Cascades Island, and WA Shore AWS LPSs remain in service.

(2) The NDE Lamprey Flume Structure (LFS) remains in service.

(3) The AFF lamprey trap remains in service.

(4) The Bradford Island Lamprey Wetted Wall remains in service.

f. Avian Monitoring. Bird counts are recorded between 01 April and 31 October.

Date	Gulls	Cormorants	Terns	Wh. Pelicans	Grebes
6/10	0	1	0	0	0
6/11	0	1	0	0	0
6/12	0	4	0	0	0
6/13	0	4	0	0	0
6/14	1	2	0	0	0
6/15	0	0	0	0	0
6/16	0	6	0	0	0


WATER QUALITY MONITORING:

a. Fishway Temperatures. Temperatures are taken from 01 March through 30 November.

(1) Table 4. Average daily fishway water temperatures (Fahrenheit).

Date	A-Branch	B-Branch	BI Exit	WA Shore	AFF	SMF	BI LPS	CI LPS	WA AWS LPS	LFS	Forebay
10-Jun	60.2	60.2	60.3	59.2	60.1	60.2	60.5	60.3	60.5	60.3	60.3
11-Jun	60.3	60.3	60.3	59.1	60.2	60.2	60.6	60.5	60.6	60.4	60.4
12-Jun	60.6	60.6	60.7	59.5	60.5	60.6	60.9	60.9	60.9	60.7	60.7
13-Jun	60.8	60.8	60.9	59.6	60.6	60.7	61.1	60.9	61.0	60.8	60.9
14-Jun	60.5	60.5	60.6	59.5	60.4	60.5	60.8	60.8	60.8	60.6	60.6
15-Jun	60.8	60.9	61.0	59.7	60.7	60.8	61.2	61.1	61.1	60.9	61.1
16-Jun	61.0	61.1	61.2	59.9	60.9	61.0	61.4	61.2	61.3	61.1	61.2

(2) Figure 1. Graph of fishway water temperatures (Fahrenheit).

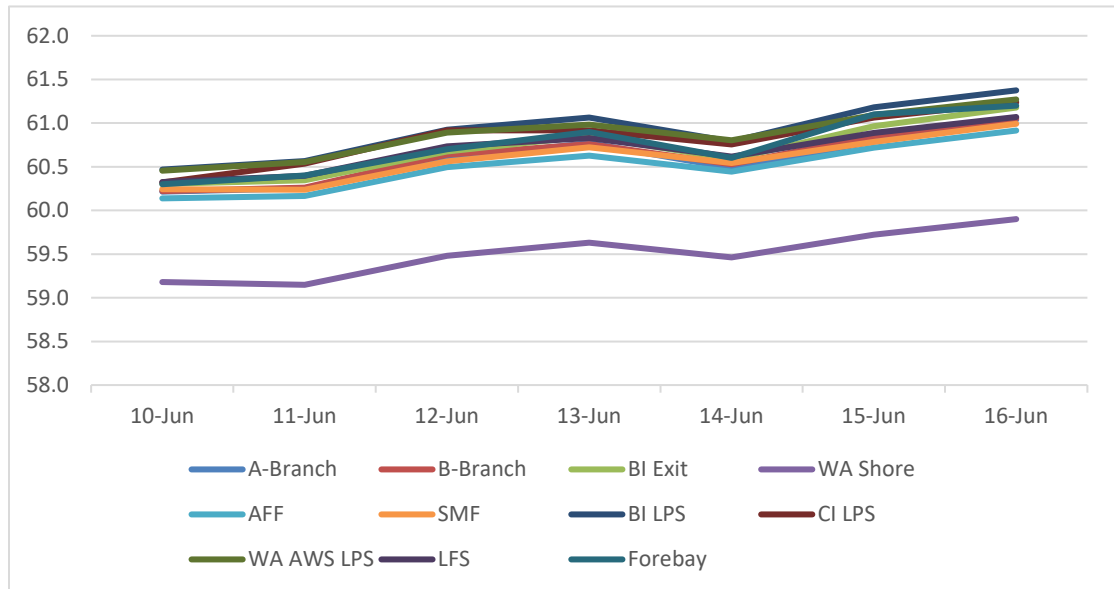

(3) Zebra Mussel Monitoring. No signs of colonization were observed this reporting week.

6. CONSTRUCTION: Construction on the PH2 re-roofing project has begun.

7. HAZMAT, SPILLS AND CLEANUP: Nothing to report.

8. TELETYPES CURRENTLY IN EFFECT:

- a. A teletype sent on 13 June describes the summer spill pattern for BONN, to be operated in accordance with the 2018 Summer Fish Operations Plan. The target spill rate alternates every two days between 95 kcfs and 85 kcfs day/121 kcfs night.
- b. A teletype sent on 13 June requests that BONN operate within a 1.5 foot band for the Treaty Fishery during the periods of 0600 Monday, 18 June, to 1800 Friday, 25 June, and 0600 Monday, 25 June, to 1800 Friday, 29 June.

MICHAEL ADAMS, P.E.
Operations Manager (Acting)
Bonneville Project