

## MEMORANDUM FOR Biologist, Operations Division (CENWP-OD)

SUBJECT: Bonneville Project, Fishway and Fish Activities for **Week 25** of 2019, which covers the period from **16-22 June**.

**1. OPERATION SUMMARY:**

a. Daily average river flows ranged from 171.1 to 205.3 kcfs. Daily average powerhouse forebay elevation ranged from 74.5' to 74.9' msl. Daily average project tailwater ranged from 14.6' to 16.7' msl. Secchi disk measurements ranged from 4.0' to 5.0'. Daily average water temperature ranged from 63°F - 64°F.

b. Daily average spill ranged from 95.1 to 95.3kcfs.

c. Unit Operation. PH2 remains the priority powerhouse. Main unit drawdowns are measured every Monday and more frequently as needed.

- Table 1. Main Unit Outages.

Unit	OOS Date	RTS Date	Reason
2	0001 on 10 June	---	P.O., Annual, Air cooler Replacement
9	0001 on 17 June	---	MU1 on bank 9/10

d. Fish Units. Second Powerhouse fish units provide attraction flow for the Washington Shore (WS) fish ladder.

- Fish Unit Outages. Fish Units are periodically placed into reserve service (RS) to float trash when debris differentials become excessive and trash raking is not possible.

- Table 2. Fish Unit Outages.

Unit	OOS Date	RTS Date	Reason
F2	2132 on 15 June	0435 on 16 June	RS, Nighttime Lamprey Ops.
F1	2133 on 16 June	0431 on 17 June	RS, Nighttime Lamprey Ops.
F1	2131 on 17 June	0428 on 18 June	RS, Nighttime Lamprey Ops.
F2	2130 on 18 June	0443 on 19 June	RS, Nighttime Lamprey Ops.
F1	2130 on 19 June	0422 o 20 June	RS, Nighttime Lamprey Ops.
F2	2130 on 20 June	0430 on 21 June	RS, Nighttime Lamprey Ops.
F1	2130 on 21 June	0432 on 22 June	RS, Nighttime Lamprey Ops.
F2	2144 on 22 June	---	RS, Nighttime Lamprey Ops.

Table 3. Fish unit drawdowns, in feet.

Date	F1	F2
6/16	---	---
6/17	---	---
6/18	---	---
6/19	0.2'	0.2'
6/20	0.1'	0.3'
6/21	0.5'	0.4'
6/22	0.3'	0.7'

## **2. MAINTENANCE ACTIVITIES:**

### **a. Auxiliary Water System Closures.**

- FV4-3 / FV4-4 were taken out of service (intake bulkheads on sill) from 1330 on 17 June until 1540 on 18 June. More information can be found [19BON12 MFR FV4-4 Failure](#).
- FV1-1 was closed for cleaning from 1253 until approximately 1323 on 20 June.

### **b. STS/VBS Inspections.** Nothing to report.

### **c. Dewatering and Fish Salvages.** Nothing to report.

## **RESEARCH:**

### **a. Four Peaks Environmental - Fish counting contract:** Daytime visual counting (0500 to 2100) began on 01 April. Nighttime video counting (2100 to 0500) began on 15 May. Fish counts can be viewed [here](#).

### **b. PSMFC – Smolt Monitoring Facility:** Sample collections at the SMF began at 0700 on 02 March. Debris at the PDS and fish/debris separator ranged from light to light-moderate consisting mostly of sticks and other woody debris. GBT examinations began on 13 April and are typically performed two days per week through the end of spill. Results of this week's GBT examinations: 200 yearling Chinook, subyearling Chinook and steelhead examined: no GBT symptoms observed. Please follow this [link](#) to the FPC web page for further details. Fallbacks observed this week: one Steelhead, five salmon. No fish collections for research were conducted this week.

### **c. CRITFC – Adult Salmonid Sampling:** Adult Salmonid sampling in the AFF began on 30 April and typically occurs 5 days per week.

### **d. NOAA (Frick) – Bradford Island Lamprey Wetted Wall:** Evaluation of the Bradford Island wetted wall commenced for the second year on 17 April.

- e. Whooshh Innovations: Evaluation of a proprietary fish identification system commenced in coordination with CRITFC’s adult salmonid sampling efforts in the AFF on 30 April.
- f. University of Idaho – Lamprey Evaluations: Collection and tagging in association with Corps funded research commenced with the start of the Lamprey Flume Structure (LFS) and AFF lamprey traps on 13 May.
- g. CRITFC – Adult Pacific Lamprey Translocation: Trapping efforts at the Bradford Island and Washington Shore picketleads, Cascades Island AWS, and in conjunction with University of Idaho collections began on 28 May.

**3. FISHWAYS:**

- a. Project biologists inspected from 16-22 June.
- b. Fish passage plan observations.

- Table 4. FPP out of criteria items.

Date	Location	FPP Violation	Cause	Response
Bradford Island				
6/16-21	FG3-5	Open TW < 16.7'	Caution Card	NA
6/17	FG3-24	Open TW < 16.0'	Unknown	Ops Adjusted
6/16-18	B-Branch Entrance	Differential < 1.0'	FV4-4 Failure	WO
6/18,20	PH1 South (WG-2)	Differential < 1.0'	Unknown	NA
Cascades Island – Nothing to report.				
Washington Shore – Nothing to report.				

- On 01 May 2018, FG6-11 (Cascades Island) was found broken partially open. The diffuser shaft had broken away from the motor. Due to the subsidence issues at Cascades Island, repairs cannot occur until crane support is allowed in the vicinity.
- On 18 August 2018, FG6-12 (Cascades Island) was found to be mechanically bound in the open position. FG6-12 should only be open with tailwaters ranging from 11.0’-33.0’. Due to the subsidence issues at Cascades Island, repairs cannot occur until crane support is allowed in the vicinity.
- On 27 March 2019, FG6-18 (Cascades Island) was found to be mechanically bound in the closed position. FG6-18 should be open with tailwaters > 12.0’. Due to the subsidence issues at Cascades Island, repairs cannot occur until crane support is allowed in the vicinity.

c. Adult Fishways.

- (1) The AFF remains in service.
- (2) Sensor calibration occurred did not occur this reporting week.
- (3) SLEDs are installed at all locations.

d. Juvenile Fishways.

- (1) The ITS remains open (auto-chain gates 3B, 6C, & 10B only).
- (2) The hydro-cannon remains in service.
- (3) The B2CC remains in service.
- (4) The DSM remains in service.
  - The DSM emergency release gate (ERG) was tripped for approximately 6 minutes (1444-1450 on 19 June) during a UPS installation for the DSM PLC controls.
- (5) STSs are installed.

e. Lamprey Fishways. All LPSs remain in service.

- (1) The Bradford Island Wetted Wall (BIWW) began operations on 17 April.
- (2) The PH2 Lamprey Flume Structure (LFS) began trapping on 13 May.
- (3) The AFF Lamprey trap began trapping on 13 May.

f. Avian Monitoring. Avian counts are recorded 01 April – 31 October.


(1) Table 5. Avian Counts.

Date	Gulls	Cormorants	Terns	Wh. Pelicans	Grebes
6/16	0	4	0	0	0
6/17	0	9	0	0	0
6/18	1	4	0	0	0
6/19	4	10	0	0	0
6/20	0	0	0	0	0
6/21	0	5	0	0	0
6/22	0	0	0	0	0

**4. WATER QUALITY MONITORING:**

a. Fishway Temperatures. Temperatures are taken from 01 March through 30 November.

Date	A-Branch	B-Branch	BI_Exit	WA_Exit	AFF	SMF	BI_LPS	CI_LPS	WA_LPS	LFS	Forebay
16-Jun	63.3	63.2	63.4	63.0	62.9	63.0	63.7	63.3	63.3	63.2	62.9
17-Jun	63.6	63.7	63.8	63.6	63.5	63.6	64.1	64.0	63.9	63.8	63.5
18-Jun	64.3	64.3	64.4	64.3	64.2	64.3	64.6	64.6	64.6	64.6	64.2
19-Jun	64.2	64.2	64.3	64.1	64.1	64.2	64.5	64.3	64.4	64.3	64.1
20-Jun	63.7	63.7	63.8	63.7	63.6	63.7	64.0	63.9	64.0	63.8	63.6
21-Jun	63.5	63.6	63.6	63.6	63.5	63.6	63.8	63.8	63.9	63.7	63.5
22-Jun	63.6	63.7	63.7	63.7	63.6	63.7	63.9	64.0	64.0	63.8	63.6

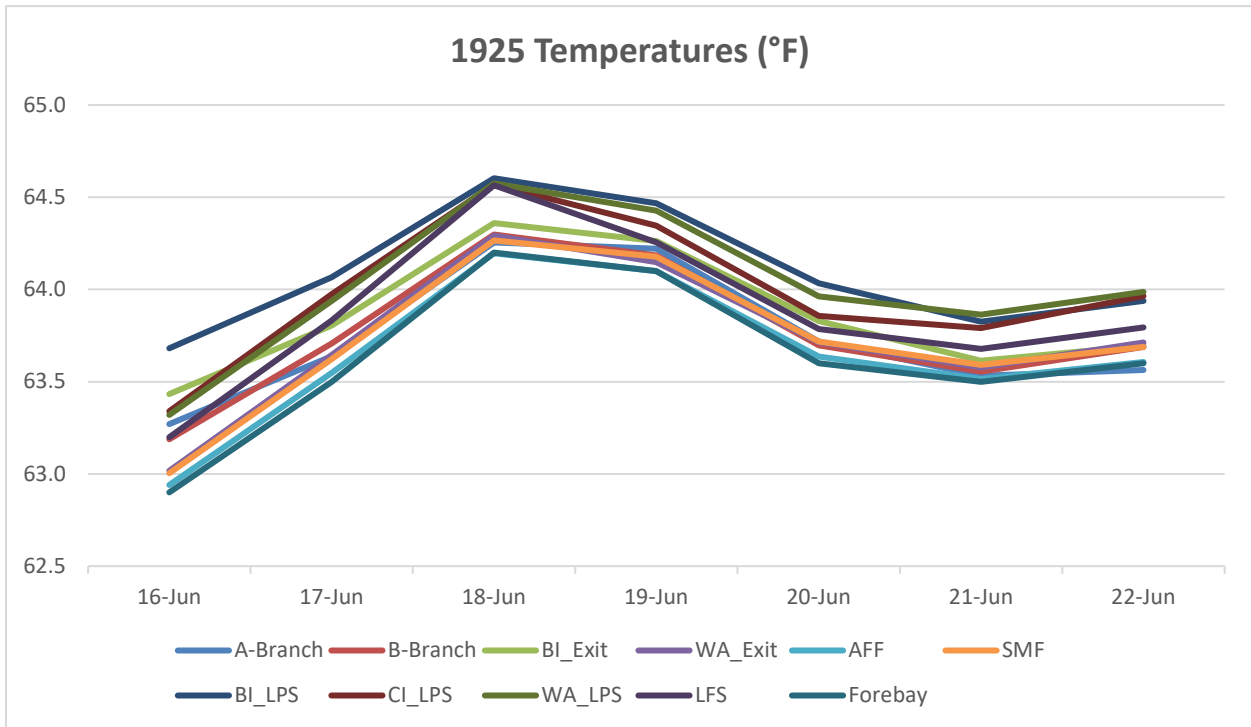

b. Zebra Mussel Monitoring. No signs of colonization were observed this reporting week.

**5. CONSTRUCTION:** Nothing to report

**6. HAZMAT, SPILLS AND CLEANUP:** Nothing to report.

**7. TELETYPES CURRENTLY IN EFFECT:**

- a. A teletype sent on 12 June states effective 16 June through 31 August, operate Bonneville Dam in accordance with the 2019 FOP to provide summer spill for fish passage, spill according to patterns in the 2019 FPP, and keep the B2CC open until within one hour of the end of spill on 31 August.
- b. A teletype sent on 14 June requests that Bonneville pool operate within a 1.5' band, hard constraint, from 0600 on 17 June until 1800 on 22 June and from 0600 on 24 June until 1800 on 26 June to facilitate treaty fishing.
- c. A teletype sent on 16 June updates the spill caps estimated to meet but not exceed the 120% TDG gas cap.

MICHAEL ADAMS, P.E.  
Operations Manager  
Bonneville Project