CENWP-ODB

MEMORANDUM FOR Biologist, Operations Division (CENWP-OD)

SUBJECT: Bonneville Project, Fishway and Fish Activities for <u>Week 35</u> of 2021, which covers the period from <u>22</u> to 28 August 2021.

1. OPERATION SUMMARY:

a. Daily average river flows ranged from 108.9 to 140.7 kcfs. Daily average powerhouse forebay elevation ranged from 74.4' to 75.2' msl. Daily average project tailwater ranged from 10.6' to 12.6' msl. Secchi disk measurements remained at 7.0'. Daily average water temperature ranged from 69°F to 70°F.

b. Daily average spill ranged from 51.1 to 51.4 kcfs. Summer spill season began on 16 June and will continue through 31 August in accordance with FOP guidelines.

c. <u>Unit Operation</u>. **PH2** remains the priority powerhouse. Main unit drawdowns are measured every Monday and more frequently as needed.

•	Table	1. Main	Unit	Outages
---	-------	---------	------	---------

Unit	OOS	RTS	Reason	Duration
2	0012 on 09 Aug		P.O., Annual Overhaul	

d. <u>Fish Units</u>. Second Powerhouse fish units provide attraction flow for the Washington Shore (WS) fish ladder.

<u>Fish Unit Outages</u>. Fish Units are periodically placed into reserve service (RS) to float trash when debris differentials become excessive and trash raking is not possible.

Unit	OOS/RS	RTS	Reason	Duration
F2	2129 on 21 Aug	0559 on 22 Aug	R.S., Nighttime Lamprey Ops	8 hours, 30 mins
F1	2129 on 22 Aug	0558 on 23 Aug	R.S., Nighttime Lamprey Ops	8 hours, 29 mins
F2	2130 on 23 Aug	0617 on 24 Aug	R.S., Nighttime Lamprey Ops	8 hours, 47 mins
F1	2128 on 24 Aug	0600 on 25 Aug	R.S., Nighttime Lamprey Ops	8 hours, 32 mins
F2	2129 on 25 Aug	0600 on 26 Aug	R.S., Nighttime Lamprey Ops	8 hours, 31 mins
F1	2130 on 26 Aug	0559 on 27 Aug	R.S., Nighttime Lamprey Ops	8 hours, 29 mins
F2	2130 on 27 Aug	0602 on 28 Aug	R.S., Nighttime Lamprey Ops	8 hours, 32 mins
F1	2130 on 28 Aug		R.S., Nighttime Lamprey Ops	

• Table 2. Fish Unit Outages.

• Table 3. Fish Unit Drawdowns, in Feet.

Date	F1	F2
08/22	0.5'	0.2'
08/23	0.2'	0.4'
08/24	0.5'	0.1'
08/25	0.2'	0.6'
08/26	0.3'	0.2'
08/27	0.3'	0.5'
08/28	0.3'	0.1'

2. MAINTENANCE ACTIVITIES:

- a. <u>Auxiliary Water System Closures</u>.
 - FV 3-7 (Bradford Island) was placed in manual and pinched down to reduce flow in the BI AWS to

prevent blown diffuser grating and further damage to FG 3-3. FG 3-4, FG 3-5, and FG 3-6 are all OOS due to mechanical failure. These settings for the A-Branch AWS and diffusers will likely remain until the problems can be addressed during the 2021-2022 winter maintenance period. Please see 21BON014 MFR A-Branch FV 3-7 and FG 3-4,5,6 OOC for further explanation. http://pweb.crohms.org/tmt/documents/FPOM/2010/

- b. <u>STS/VBS Inspections</u>. Nothing to report.
- c. <u>Dewatering and Fish Salvages</u>. Nothing to report.

3. RESEARCH:

- a. <u>Four Peaks Environmental Fish counting contract</u>: Daytime visual counting (0500 to 2100 PDT) began on 01 April. Night video (2100 to 0500 PDT) counting began 15 May. Fish counts can be viewed <u>here</u>.
- b. <u>USFWS Lamprey Metamorphosis Study</u>: Juvenile lamprey researchers are onsite, and the work is underway. Researchers are installing lights on tanks for photoperiod.
- c. <u>Pacific States Marine Fisheries Commission Smolt Monitoring:</u> Sample collections at the SMF began at 0700 on 02 March. Debris at the primary dewatering structure (PDS) and fish/debris separator was light consisting mostly of aquatic macrophytes, a few sticks and dead adult American shad. Higher temperature sampling protocols were initiated on 07 July (sample end-date of 08 July) when water temperatures ascended to 70°F. Modified sampling during higher temperatures means Index/Condition sampling will take place every other day until the daily average descends to 69.5°F. Sample and bypass mode will occur on alternating 24-hour periods (0700-0700). Normal sampling operations (24-hour sampling, everyday) resumed on 24 August (Sample end-date of 25 August) when average daily forebay temperatures descended to 69.5°F

temperatures, low TDG levels and the inability to meet the 50 fish minimum sample size criteria. No fallbacks were observed this week. Truck releases of summer/fall out-migrants originating from Little Goose and Lower Granite dams continued at Bonneville every other day. No fish collections for research purposes were conducted this week. More details can be found on the **FPC web page**.

- d. <u>USDA Pinniped and Avian Hazing</u>: Deck-based hazing continues for the late summer/fall season.
- e. <u>WDFW/ PSMFC Pikeminnow Sampling</u>: Hook and line angling activities continue for native nonsalmonid fish species within the BON BRZ as a constituent of Gas Bubble Trauma (GBT) monitoring.
- f. <u>CRITFC Adult Salmonid Sampling</u>: Adult Salmonid sampling in the AFF began on 20 April and typically occurs 5 days per week. Normal sampling protocols are in place.
- g. <u>WDFW Bright and Tule Chinook Stock Observation</u>: Observation research of fall Chinook at Bonneville Dam started on 01 August.

4. FISHWAYS:

- a. Project biologists inspected 22 to 28 August.
- b. Fish Passage Plan observations.

• Table 4. FPI	P Items Out of Criteria.	1	r	1					
Date	Location	FPP Violation Cause		Response					
PH1									
	S. End Gate								
		S. End Gate	S. End Gate Inoperable, 1a						
		Inoperable and Chain							
08/22-28	PH1 ITS	Gates 1a & 1b Closed	Safety Reasons	W.O.					
		Bradford Island							
			FG 3-4						
			Mechanically						
		FG 3-4 Partially	Bound Partially						
08/22-28	A-Branch	Open	Open/Closed	W.O.					
			FG 3-27						
			Mechanically						
		FG 3-27 Open,	Bound in the						
08/22-23, 26-28	B-Branch	Should be Closed	Open Position	Caution Order					
			Currently in						
08/22-28	BI Exit	FV 3-7 High	Manual	Caution Order					
		Cascades Island.							
		CI Entrance							
08/22	CI Entrance	Bay/TW Diff >2.0'	PLC Issues	W.O.					
			FG 6-12						
	FG 6-12 Open, Mechan		Mechanically	W.O., Repaired on					
08/22	CI Fishway	Should Be Closed Bound		8/24					
	Washin	gton Shore. Nothing to F	Report.						
08/26	WA Shore Fishway	Weir 37 High >1.1'	Unknown	N.A.					

- FV 3-7 (Bradford Island) was placed in manual and pinched down to reduce flow in the BI AWS to prevent blown diffuser grating and further damage to FG 3-3. These settings for the A-Branch AWS and diffusers will likely remain until the problems can be addressed during the 2021-2022 winter maintenance period.
- FG 3-4 (A-Branch) was found mechanically bound and unable to move from the "almost closed" position in December of 2020. This diffuser will likely remain in this position until the 2021-2022 winter maintenance period.
- FG 3-5 (A-Branch) was not operating correctly on 07 June 2021 and was banging heavlily underwater due to an assumed broken fish gate. To prevent futher damage to the fishway and equipment, a clearance has been issued for FG 3-5 to be closed and taken out of service until the winter maintenance period.
- FG 3-6 (A-Branch) was found mechanically bound in the closed position on 07 June 2021. This diffuser will likely remain in this position until the 2021-2022 winter maintenance period.

c. Adult Fishways.

- (1) The AFF remains in service.
- (2) Sensor calibration occurred on 23 August for PH1Collection Channel and 24 August for Spillway.
- (3) SLEDs are installed at all locations.
- (4) Cascades Island Fishway and Washington Shore Fishways are in service.
- (5) Bradford Island Fishway is in service.
- d. Juvenile Fishways.

- (1) The ITS remains in service (auto-chain gates 3B, 6C, & 10B only).
- (2) The hydro-cannon remains in service.
- (3) The B2CC remains in service.
- (4) The DSM remains in service.
- (5) STSs remain in service.
- e. Lamprey Fishways.
 - (1) BI, CI, and WA Shore LPS's remain in service.
 - (2) The Bradford Island Wetted Wall (BIWW) remains out of service.
 - (3) The PH2 Lamprey Flume Structure (LFS) was taken out of service on 14 August due to warm water trap operation protocols.
 - (4) The AFF lamprey trap remains in service
 - (5) The CI Lamprey trap remains in service
- f. Avian Monitoring. Avian counts are recorded 01 April 31 October.

 Table 5. Avian Counts for 22 to 28 August.

Date	Gulls	Cormorants	Terns	Wh. Pelicans	Grebes
08/22	91	19	0	0	0
08/23	42	0	0	0	0
08/24	49	10	0	0	0
08/25	40	23	0	0	0
08/26	56	27	0	0	0
08/27	63	9	0	0	0
08/28	52	25	0	0	0

5. WATER QUALITY MONITORING:

a. Fishway Temperatures. Temperature logs began on 28 February and will continue through 30 November.

 Table 6. Bonneville Fishway Temperatures for 22 to 28 August.

Date	A- Branch	B- Branch	BI_Exit	WA_Entrance	CI_Entrance	WA_Exit	CI_LPS	WA_LPS	BI LPS	AFF	LFS	SMF	Forebay
22- Aug	70.0	**	70.0	70.2	70.1	70.1	70.2	70.3	70.2	70.0	***	70.2	70.0
23- Aug	69.6		69.8	69.7	69.6	69.6	69.7	69.8	70.0	69.5		69.6	70.0
24- Aug	69.4		69.5	69.5	69.4	69.4	69.6	69.7	69.7	69.3		69.4	69.0
25- Aug	69.6		69.7	69.9	69.9	69.9	70.0	70.1	69.9	69.7		69.8	70.0
26- Aug	69.8		69.9	69.7	69.7	69.7	69.8	69.9	70.2	69.6		69.7	70.0
27- Aug	69.7		69.8	69.9	69.8	69.8	69.9	70.0	70.0	69.7		69.8	70.0
28- Aug	69.8		69.9	69.9	69.8	69.9	70.0	70.1	70.2	69.7		69.8	70.0

The LFS Trap was dewatered and taken out of service on the morning of 14 August

B-Branch Entrance temp. probe failed this week and is no longer serviceable. We are currently working on finding a replacement temp. probe

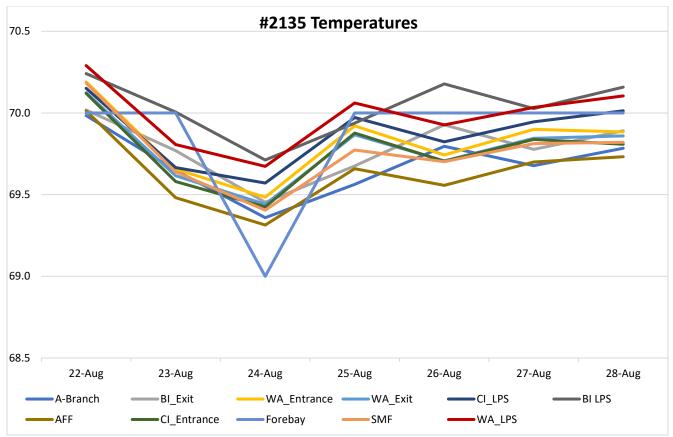


Figure 1. Average fishway temperatures for 22 to 28 August at Bonneville Lock & Dam.

- b. <u>Zebra Mussel Monitoring</u>. No signs of colonization were observed this reporting week.
- 6. CONSTRUCTION: Nothing to report.
- 7. HAZMAT, SPILLS AND CLEANUP: Nothing to report
- 8. TELETYPES CURRENTLY IN EFFECT:
 - A teletype sent out on 11 June stating effective 16 June at 0001 hours through 31 August at 2359 hours, Bonneville Dam is to operate in accordance with the 2021 Fish Operations Plan to provide summer spill for fish passage. Please see teletype BON R 061121 1732 for more details.
 - A teletype sent out on 15 June provided guidance for summer spill caps for MCN, JDA, TDA, and BON starting at 0001 on 16 June and until further notice. Please see teletype BON R 061521 1307 for more details.
 - A teletype was sent out on 18 August requesting that Bonneville pool operate at a 1.5 ft band, hard constraint for the following periods:
 From 0600 HRS Monday August 23 to 1800 HRS Thursday August 26 2021
 From 0600 HRS Monday August 30 to 1800 HRS Thursday September 2 2021
 The purpose of this operation is for treaty fishery. Please see teletype BON R 08182021 1405 for more details.

MICHAEL ADAMS, P.E. Operations Project Manager Bonneville Project